

Information


- Product Code: 3G10WVT Telstra TURBO™ GATEWAY
- Gateway Firmware Version: 3G10WVT-L101-S306TMB-T01_R11
- Module Firmware Version(PPP Mode): K2_0_7_18BT/K2_0_7_19AP
- Hardware Version: 96358G-133V or 96358G-133VB
- Update Tool File name:
3G10WVT_FW Update Tool_T01_R11.zip
- Date: February 2, 2010

Requirements

- 1 x Computer with
 - a. Network Interface Card installed (provides Ethernet Socket)
 - b. Windows XP/Windows Vista/Windows 7 as O/S
- 1 x Ethernet cable

Upgrade Instructions


1. Connect the Ethernet cable between a PC to the LAN 1 port of the gateway.
2. Power on the gateway. If the LAN IP address of the gateway is not the default (10.0.0.138). You will need to resume it back to 10.0.0.138 (via the Web Interface) so as update can proceed.
3. Wait till you see the Local Area Connection is connected.

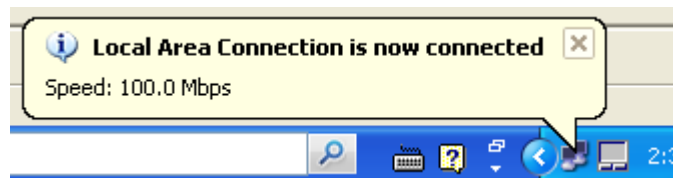

4. Obtain the zipped file and unzip it to the PC. Click on the file named "NetCommFWUpgrade.exe".



5. Click on the Update button on the pop-up window. The update will start automatically. It may take up to 12 minutes. **Please do NOT disconnect the Ethernet cable between the gateway and the computer. Please do NOT power off the gateway during the whole process.**

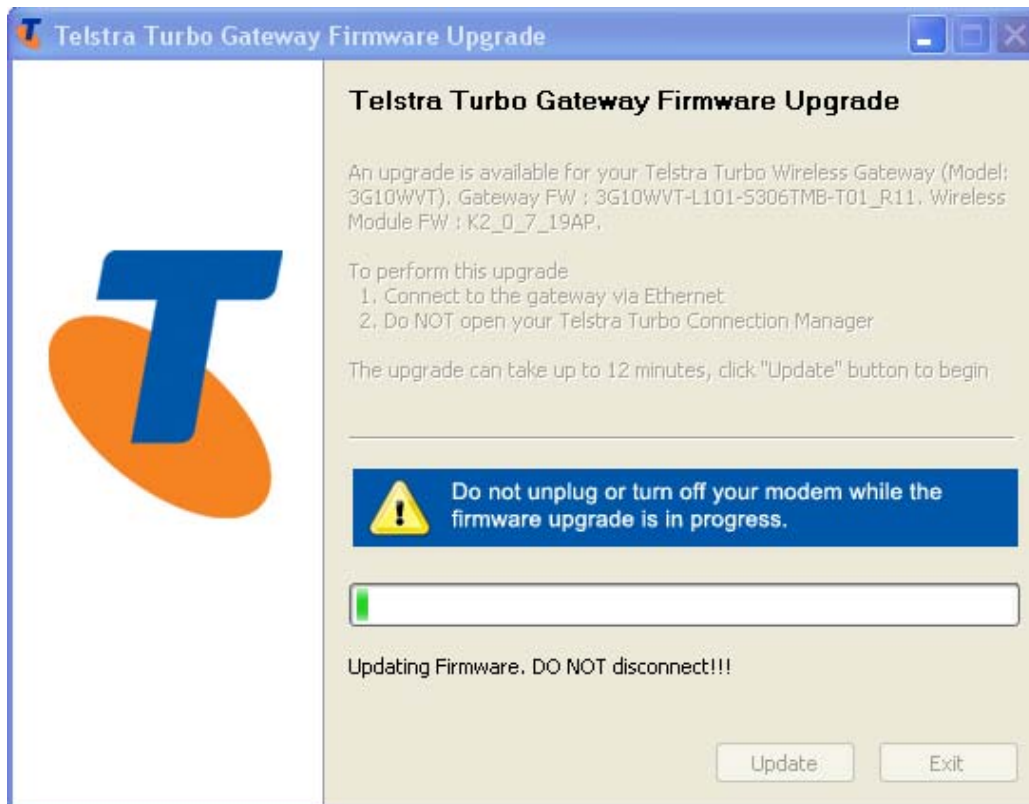

6. Once update finishes, the software will indicate it to you. You can now click on the exit button to finish.

